

Fire certificate
Old campus School



Office of the District Fire Officer, Hulimavu fire Station,
Karnataka Fire & Emergency Services,
Bannerghatta Road, Hulimavu, Bengaluru--560 076.



No:01/DFO/HMFS/FSCR/2026

Dated: 26-01-2026

"Annexure-2"

To,

The Principal
M/s Sudarshan Vidya Mandir,
School Block, U Dise Code: 29200421105
Sy No.43/1, 43/2, Sakalavara main road,
Lakshmipura Village, Anekal Taluk,
Bengaluru 560 078

Sir,

Sub : Issue of "Fire Safety Compliance Report" with respect to fire prevention, fire fighting and evacuation measures maintained at **M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bangalore 560 078"-Reg**

Ref : 1) This Office FSR No.01/DFO/HMFS/FSR/2026, Dt: 22-01-2026
2) Your request letter dated: 25-01-2026
3) FSTO Inspection Report NO: 01/FSTO/HMFS/FSCR/2026, Dt: 25-01-2026

With reference to the above cited subject, as per ref (1) Conditional Fire Safety Recommendation report was issued by the District Fire Officer, Hulimavu Fire Station to the educational premises of **M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bangalore 560 078** with a condition to fulfill the recommendation and compliance the same within 03 months.

With reference cited ref (2) above the management **M/s Sudarshan Vidya Mandir, School Block** had requested for the fire safety compliance report from our department. In this regard the above addressed educational building was re-inspected by Fire Station Officer, Hulimavu Fire Station on 25-01-2026 for issue of fire safety compliance report. And as per ref (3) submitted the report to issue of fire safety compliance report.

Under the above circumstance the Karnataka Fire & Emergency Services Department is issuing the "Fire Safety Compliance Report" to the educational premises of **M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bangalore 560 078**. Subjected to proper maintenance of fire-fighting installations in the good working conditions and must arrange for 40% of staff/employees training in fire prevention and fire fighting at R.A.Mundkur fire and emergency services academy within the 03 months from date of issue of this certificate.

In case the Fire prevention and Fire fighting measures installed as per the recommendation of the department are not maintained in good working condition, if the evacuation measures are not properly followed and if any additional construction work is taken up in the building/premises, the Fire Safety Compliance Report deemed to be cancelled and necessary legal action will be initiated against the developer/management/tenant and also separate NOC has to be obtained from the department for the storage of Chemicals, Solvents, Petroleum products (Diesel/Petrol), LPG, etc in the premises/building. This fire safety compliance is issued from the fire prevention and fire fighting point of view, The Karnataka State Fire and Emergency Services Department is not responsible for the ownership of the land, its location and other disputes, which may arise in due course

"This Fire Safety Compliance Report is valid till dt: 21-01-2027 and it is renewable.

Your Faithfully

S. Manjunath
District Fire Officer
Hulimavu Fire Station
Venugopala Nagar, Bengaluru - 560 076



Office of the District Fire Officer, Hulimavu fire Station,
Karnataka Fire & Emergency Services,
Bannerghatta Road, Hulimavu, Bengaluru--560 076.



No: 01/DFO/HMFS/FSR/2026

Dated: 22-01-2026

ANNEXURE-1

Group - B Educational Building

NBC-2016, Part-4, Table 7(11) 3.1.3 Group B Educational Buildings Sub Division B1 & B2.

(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of

NBC-2016 are mandatory

To,

The Principal

M/s Sudarshan Vidya Mandir,

School Block, U Dise Code: 29200421105

Sy No.43/1, 43/2, Sakalavara main road,

Lakshmipura Village, Anekal Taluk,

Bengaluru 560 078

Sir,

Sub : Issue of "Fire Safety Recommendation Report" with respect of fire Prevention, fire fighting and evacuation measures to be required at "M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bengaluru 560 078'-Reg.

Ref : 1. Your request letter dated: 15-01-2026
2. FSTO Inspection report No. 01/FSTO/HMFS/FSR/2026, Dated: 19-01-2026

With reference to the subject cited above, the premises of M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bengaluru 560 078 was inspected by Fire Station Officer, Hulimavu Fire Station) on 19-01-2026 with respect to Fire prevention, Fire fighting and Evacuation measures to be complied in the above premises and details are as follows.


Details of the building / premises :-

01	Name and Address of the Applicant.	:	The Principal M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bengaluru 560 078
02	Name and Address of the premises.	:	M/s Sudarshan Vidya Mandir, School Block, U Dise Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bengaluru 560 078




03	Name and address of the Building owner	:	Mrs. Hema Narayan, Director M/S Sudarshan Vidya Mandir Institutions, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bangalore 560 078												
04	Number of buildings	:	01 Building												
05	Number of floors	:	Basement, Ground & 02 upper floors												
06	<u>Floor-wise details of occupancy:-</u>														
	Basement	:	Canteen, Auditorium, Sports Room												
	Ground floor	:	11 Class room, 01 Staff room, 01 exam room, 01 Language room, 01 Computer Lab												
	1 st Floor	:	14 Class room, 01 Staff room												
	2 nd Floor	:	14 Class room, 01 Staff room												
07	Height of the building	:	13.00 mtrs												
08	Site area	:	1493.00 Sq.mtrs.												
09.	Built-up area of each floor:-	:	<table border="1"> <tr> <td>Basement</td> <td>:</td> <td>928.00 Sq.mtrs</td> </tr> <tr> <td>Ground floor</td> <td>:</td> <td>1493.00 Sq.mtrs</td> </tr> <tr> <td>1st Floor</td> <td>:</td> <td>1493.00 Sq.mtrs</td> </tr> <tr> <td>2nd Floor</td> <td>:</td> <td>1493.00 Sq.mtrs</td> </tr> </table>	Basement	:	928.00 Sq.mtrs	Ground floor	:	1493.00 Sq.mtrs	1 st Floor	:	1493.00 Sq.mtrs	2 nd Floor	:	1493.00 Sq.mtrs
Basement	:	928.00 Sq.mtrs													
Ground floor	:	1493.00 Sq.mtrs													
1 st Floor	:	1493.00 Sq.mtrs													
2 nd Floor	:	1493.00 Sq.mtrs													
10.	Total built-up area	:	5407.00 Sq.mtrs												
11.	<u>Surrounding properties:-</u>														
	East (Front)	:	08.20 meter wide Internal Road connected to sakalavar main road.												
	West (Rear)	:	Vacant Land												
	North (Side)	:	Residential												
	South (Side)	:	08.00 meter internal road												
12.	<u>Set-back area available around the building :-</u>														
	East (Front)	:	05.00 meter												
	West (Rear)	:	08.18 meter												
	North (Side)	:	06.28 meter												
	South (Side)	:	05.00 meter												

B. On inspection of this Educational premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

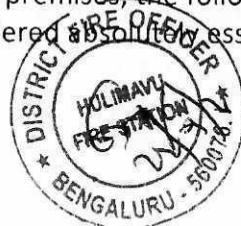

Sl. No. (1)	Details (02)	Existing (03)	Recommendations (04)																					
01.	Accessibility to the premises	The Premises is accessible from 08.20 meter wide road located on eastern side. Which is connected to sakalavara main road. The Road is hardened to carry the weight of 45,000 kgs.	Adequate																					
02.	No. of entrances	02 entrances cum exit are of 05.20 meter width and another one is of 05.85 meter width have been provided.	Complied																					
03	Width of entry / exit	02 entrances cum exit are of 05.20 meter width and another one is of 05.85 meter width has been provided.	Adequate																					
03.	Diesel generators.	Provided with diesel generator of 82.50 KVA capacities to supply alternative power supply. It is connected to all emergency lightings.	Complied																					
04.	No. of staircases available	<table border="1"> <tr> <td>Nos. of staircases</td> <td>:</td> <td>02 nos</td> </tr> <tr> <td>Width of staircases</td> <td>:</td> <td>Each of 1.80mtrs</td> </tr> <tr> <td>Width of treads</td> <td>:</td> <td>Each of 30 cms</td> </tr> <tr> <td>Height of risers</td> <td>:</td> <td>Each of 16 cms</td> </tr> <tr> <td>Nos. of riser per flight</td> <td>:</td> <td>08 nos</td> </tr> <tr> <td>Height of hand rails</td> <td>:</td> <td>1.00 mtrs</td> </tr> <tr> <td>Head room clearance</td> <td>:</td> <td>2.30 mtrs</td> </tr> </table>	Nos. of staircases	:	02 nos	Width of staircases	:	Each of 1.80mtrs	Width of treads	:	Each of 30 cms	Height of risers	:	Each of 16 cms	Nos. of riser per flight	:	08 nos	Height of hand rails	:	1.00 mtrs	Head room clearance	:	2.30 mtrs	Complied
Nos. of staircases	:	02 nos																						
Width of staircases	:	Each of 1.80mtrs																						
Width of treads	:	Each of 30 cms																						
Height of risers	:	Each of 16 cms																						
Nos. of riser per flight	:	08 nos																						
Height of hand rails	:	1.00 mtrs																						
Head room clearance	:	2.30 mtrs																						
05	Fire extinguisher	<p>A. One mechanical foam extinguisher of 9 Litre capacity & one ABC type extinguisher of 6 kgs capacity has been provided near diesel generator.</p> <p>A. One CO2 type fire extinguisher of 4.5 kgs capacity has been provided near each electrical panel board & electrical room in the building.</p> <p>B. One ABC type fire extinguisher of 06 kgs capacity has been provided as to be available within 15 mtrs. Radius.</p>	Complied.																					
06.	First aid Hose reel hose.	Provided with 02 Nos. of of Hose reel hose at each floor. Each Hose reel hose is of minimum 30m size of adequate length to reach the farthest point of	Complied.																					

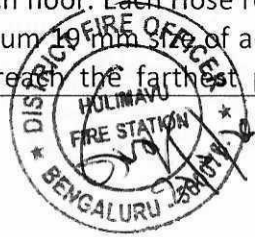

		each floor with shut off branch having nozzle of 5 mm size. The system has been connected to an overhead tank of 10,000 litres capacity with electrical pump capable of delivering 450 LPM water per minute.	
07.	Escape routes	Not provided	To be marked at each passage on each floor to visible guide the employees or student to move safer places in case of any emergency.
08.	Fire order	Not Provided.	Suggested to provide Notice boards indicating with details of action to be taken by the employees in case of any emergency or fire should be displayed with telephone number of hulimavu fire station i.e 080-22971613 and 101 telephone numbers of nearest by ambulance service should be provided at each floor.
09	Terrace tank over respective tower terrace	The system has been connected to an overhead tank of 10,000 Ltrs capacity.	Complied.
10	At the terrace tank level with minimum pressure of 3.5 kg/cm ²	The system has been connected to one Booster pump of capacity 450 LPM.	Complied.
11	Fire fighting training	Not Trained.	40% of Employees should be get trained in fire prevention and fire fighting at R.A.Mundkur fire and emergency services academy, BG Road, Bangalore- 560029.
12	Fire Siren	Not Provided	Suggested to provide one Fire siren at each floor to inform the inmates in case of a fire emergency and evacuate the area.
13	<p>General Fire precaution measures :-</p> <p>A. Explosive and flammable materials should not be stored in the store room, UPS room, Electrical panel area, class rooms, laboratory & electrical sum panel premises.</p> <p>B. Accumulation of combustibile waste in and around the premises should be avoided.</p> <p>C. The exit ways shall be always kept clear without any obstruction.</p>		



- D. Liquefied petroleum gas should be not stored in the building.
- E. The doors shall not be kept locked/latched during working hours and shall be free from obstruction.
- F. During the class hours the class room doors shall not be locked from inside to outside.
- G. As per Honourable Supreme Court order all teacher and staff shall be trained to handle safety equipment, initiate emergency evacuation and protect their students in the event of fire and other emergency and the school shall observe the Fire Safety day on April 14th of every year by conducting fire safety drills with co-ordinate with Fire Service Department.
- H. This Fire Safety Recommendation is issued from the fire prevention, fire fighting and evacuation measures. Karnataka State Fire & Emergency Services Department is not responsible for the ownership of the land, its location and other disputes, which may arise in due course.

Under the above circumstance, Karnataka State Fire and emergency Services, Department issuing the Fire Safety recommendation Report to the **M/s Sudarshan Vidya Mandir, School Block, U Dis Code: 29200421105, Sy No.43/1, 43/2, Sakalavara main road, Lakshmipura Village, Anekal Taluk, Bengaluru 560 078**. Subject to the condition and compliance the above recommendation as shown in column No 4 of Part-B as stipulated in NBC-2016 and then intimate to this office within 90 days positively without fail.

This Fire Safety Recommendation certificate is valid only for one year from the date of issue and should be renewed without fail.

- ♣ All requirements recommended above are as per National Building Code- 2016 Part-4 clause 3.1.4 of Fire and Life safety will have to be complied with mandatorily.

Yours faithfully

S. Manjunath
District Fire Officer
Hulimavu Fire Station
Venugopala Nagar, Bengaluru - 560 076